

Radon Inspection Report

Measurement of Radon Concentration in Indoor Air

Report No.: 2700005978201906041023
Serial No.: 2700005978

Report Generated Date: 6/4/19

Measurement Address:

Big Bend Ave 315
Riverton , WY 82501
United States

Measurement performed by:

Jason Rogers
Refine Home Inspection, LLC
PO Box 395
Lander , Wy 82520
info@refinehomeinspection.com
USA

Ventilation: Natural

Building type: House

Building year: 1994

Room	Floor	Measurement Start	Measurement End	Measured Value
Living room	Basement	5/31/19, 6:45 PM	6/2/19, 6:45 PM	6.7 pCi/L

Riverton

Location

June 4, 2019

Date



Signature

Detailed Measurement Data


	Min	Max	Average
Radon [pCi/L]	2.8	10.3	6.7
Temperature [°F]	63.7	65.8	64.7
Humidity [%rH]	55	66	63
Pressure [kPa]	84.36	85.06	84.69

Radon measurements for hour 1 to hour 48


Hour	Radon conc. [pCi/L]
5/31/19, 6:45 PM	8.2
5/31/19, 7:45 PM	5.7
5/31/19, 8:45 PM	7.9
5/31/19, 9:45 PM	5.0
5/31/19, 10:45 PM	7.2
5/31/19, 11:45 PM	7.5
6/1/19, 12:45 AM	7.2
6/1/19, 1:45 AM	8.3
6/1/19, 2:45 AM	8.3
6/1/19, 3:45 AM	8.8
6/1/19, 4:45 AM	8.3
6/1/19, 5:45 AM	7.3
6/1/19, 6:45 AM	9.3
6/1/19, 7:45 AM	7.6
6/1/19, 8:45 AM	7.9
6/1/19, 9:45 AM	6.8
6/1/19, 10:45 AM	8.1
6/1/19, 11:45 AM	9.4
6/1/19, 12:45 PM	6.1
6/1/19, 1:45 PM	5.9
6/1/19, 2:45 PM	6.9
6/1/19, 3:45 PM	4.8
6/1/19, 4:45 PM	4.1
6/1/19, 5:45 PM	4.3

Hour	Radon conc. [pCi/L]
6/1/19, 6:45 PM	3.3
6/1/19, 7:45 PM	2.8
6/1/19, 8:45 PM	5.3
6/1/19, 9:45 PM	4.6
6/1/19, 10:45 PM	4.8
6/1/19, 11:45 PM	4.6
6/2/19, 12:45 AM	6.9
6/2/19, 1:45 AM	4.8
6/2/19, 2:45 AM	7.1
6/2/19, 3:45 AM	6.3
6/2/19, 4:45 AM	8.3
6/2/19, 5:45 AM	10.1
6/2/19, 6:45 AM	10.3
6/2/19, 7:45 AM	5.8
6/2/19, 8:45 AM	4.8
6/2/19, 9:45 AM	6.0
6/2/19, 10:45 AM	8.6
6/2/19, 11:45 AM	8.1
6/2/19, 12:45 PM	6.8
6/2/19, 1:45 PM	5.0
6/2/19, 2:45 PM	6.0
6/2/19, 3:45 PM	7.1
6/2/19, 4:45 PM	5.5
6/2/19, 5:45 PM	6.0

Radon Chart

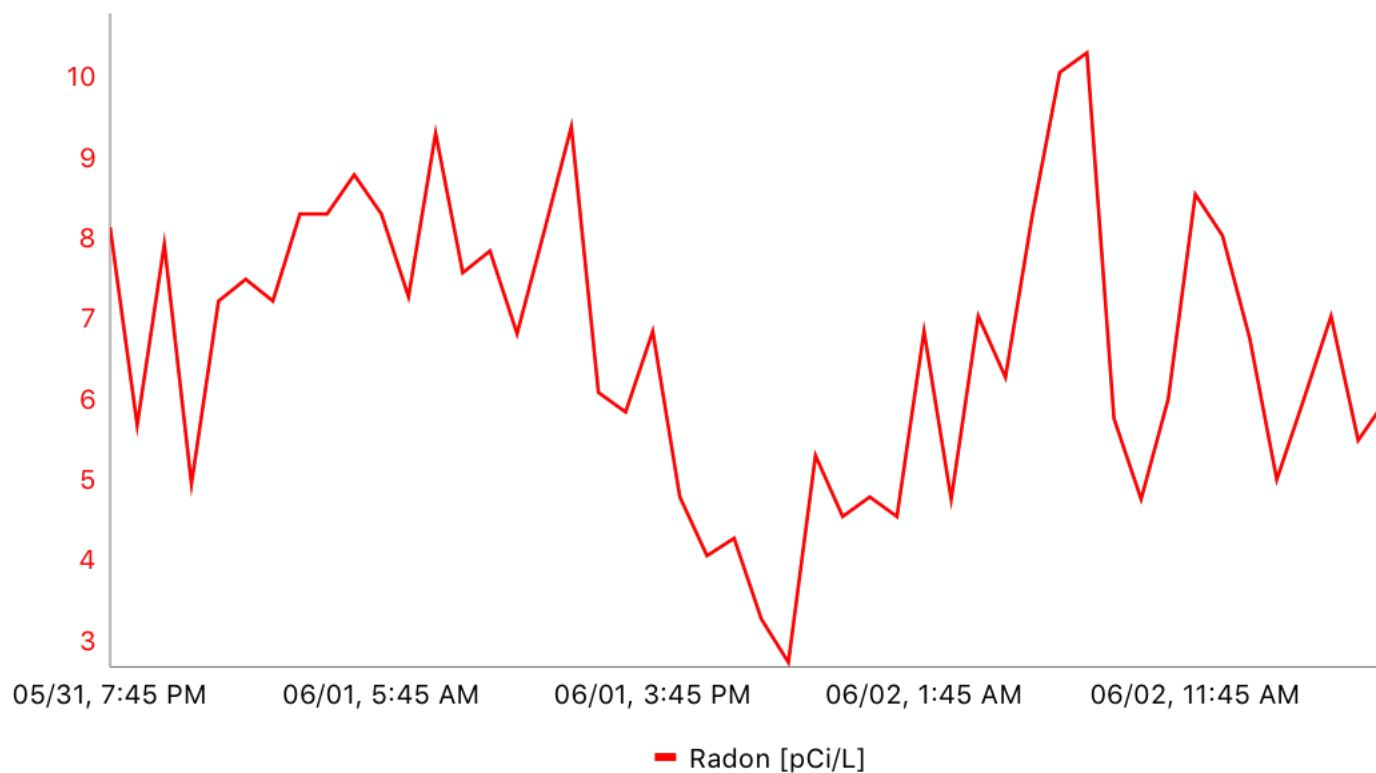

Humidity and Temperature Chart

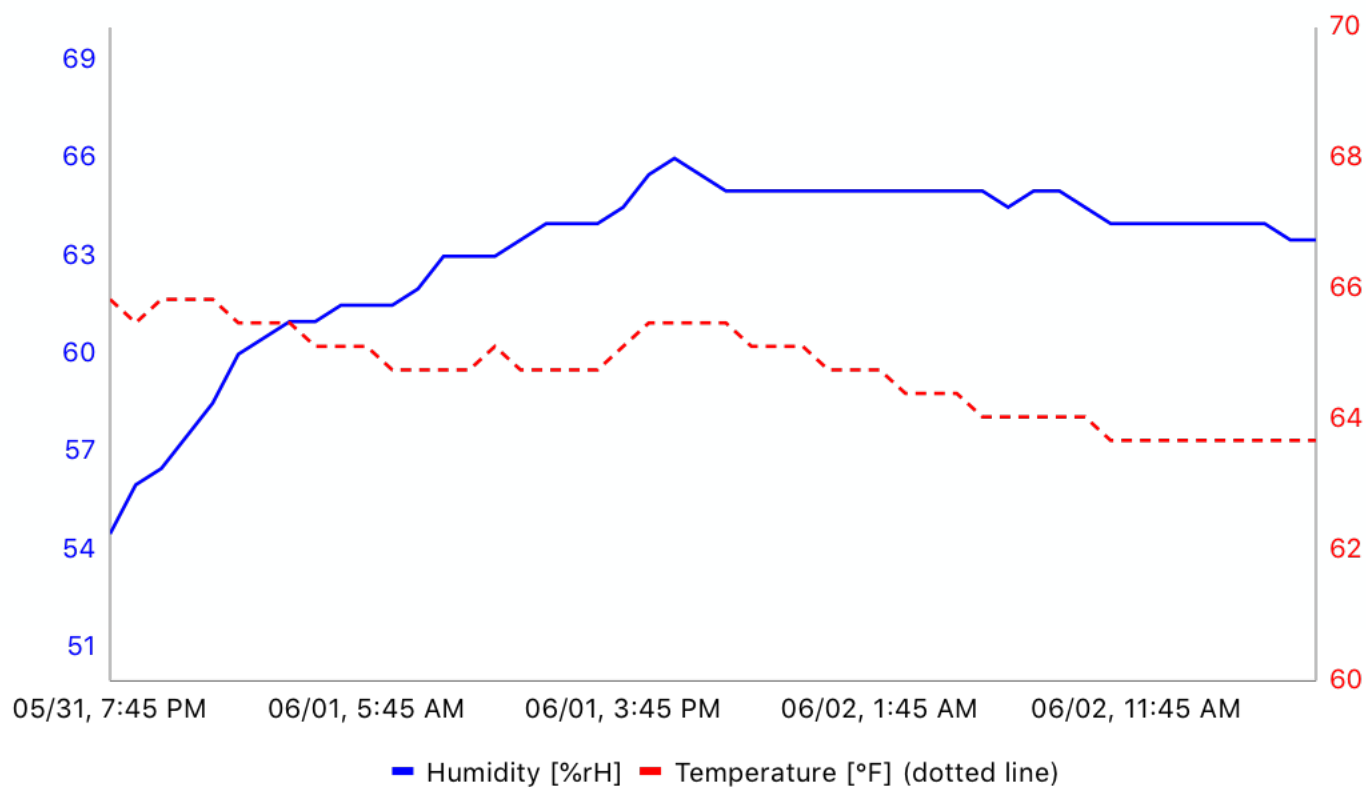

Pressure Chart

